

Project 86-060-38
April 1996



As-Built Report

South Cell Final Reclamation

Church Rock Site
Gallup, New Mexico

Submitted To:

UNC Mining and Milling
A Division of United Nuclear Corp.
Gallup, New Mexico

Prepared By:

Smith Environmental Technologies Corporation
304 Inverness Way South, Suite 200
Englewood, Colorado 80112
Phone: 303-790-1747
Fax: 303-799-0186

Project 86-060-38
August 1996



As-Built Report

South Cell Final Reclamation

Church Rock Site
Gallup, New Mexico

Prepared For:

UNC Mining and Milling
A Division of United Nuclear Corporation
Gallup, New Mexico

As-Built Report

South Cell Final Reclamation



TABLE OF CONTENTS

	<u>PAGE</u>
LIST OF TABLES	i
LIST OF FIGURES	ii
LIST OF APPENDICES	iii
1.0 INTRODUCTION	1
2.0 RADON ATTENUATION LAYER	3
2.1 Construction Methods and Materials	3
2.2 Specifications and Testing	4
2.2.1 Survey Control	5
2.2.2 Soil Properties	5
2.2.3 Field Density	6
2.2.4 Proctor Tests	6
3.0 EROSION PROTECTION COVER	8
3.1 Construction Methods and Materials	8
3.2 Specifications and Testing	9
3.2.1 Rock Mulch Quality	9
3.2.2 Rock Mulch Thickness and Size Gradation	10
3.2.3 Soil Thickness and Penetration	11
4.0 SURFACE WATER CONTROL STRUCTURES	12
4.1 Branch Swales H, I, and J	12
4.1.1 Construction Methods and Materials	13
4.1.2 Specifications and Testing	14



TABLE OF CONTENTS (Continued)

	<u>PAGE</u>
4.1.2.1 Field Modifications	15
4.1.2.2 Survey Control	16
4.1.2.3 Subgrade Density Testing	16
4.1.2.4 Radon Attenuation Layer Testing	17
4.1.2.5 Bedding Layer Testing	18
4.1.2.6 Riprap Testing	19
4.2 Runoff Control Ditch	21
4.2.1 Construction Methods and Materials	21
4.2.2 Specifications and Testing	22
4.2.2.1 Survey Control	23
4.2.2.2 Subgrade Density Testing	23
4.2.2.3 Bedding Layer Testing	24
4.2.2.4 Riprap Testing	24
5.0 CLOSING REMARKS	26
REFERENCES	
TABLES	
FIGURES	
APPENDICES	



LIST OF TABLES

<u>TABLE NUMBER</u>	<u>TITLE</u>
1	Earthmoving Equipment
2	Swales H, I, and J, Design Parameters

LIST OF FIGURES

<u>SHEET NUMBER</u>	<u>DRAWING NUMBER</u>	<u>TITLE</u>
1	86-060-A1032	Site Vicinity Map
2	86-060-E1047	Final Reclamation Plan, South End
3	86-060-E1034	Soil Cover and Surface Water Control Details
4	86-060-B1035	South Cell Final Reclamation, As-Built Conditions

LIST OF APPENDICES

<u>APPENDIX</u>	<u>TITLE</u>
A	Field Reports (Borrow Pit No. 2 and South Cell)
B	Physical Properties of Soils, Radon Attenuation Cover
C	Field Density Tests, Radon Attenuation Cover
D	Proctor Tests, Radon Attenuation Cover
E	Rock Quality Determinations, Rock Mulch and Riprap
F	Rock Gradation Tests, Rock Mulch and Riprap
G	Rock Mulch Thickness
H	Soil/Rock Matrix Measurements
I	Field Modifications, South Cell Swales
J	Test Results, Swales H, I, and J
K	Bedding Material Gradation Tests
L	Test Results, Runoff Control Ditch



AS-BUILT REPORT

SOUTH CELL FINAL RECLAMATION UNITED NUCLEAR CORPORATION CHURCH ROCK FACILITY GALLUP, NEW MEXICO

1.0 INTRODUCTION

This report describes the construction of the final reclamation cover for the South Cell of the uranium tailings disposal area at United Nuclear Corporation's (United Nuclear's) Church Rock facility. The site is located northeast of Gallup, New Mexico, along State Highway 566, as shown on Sheet 1. United Nuclear is continuing reclamation of the site as scheduled, in accordance with the "Tailings Reclamation Plan as Approved by the NRC March 1, 1991, License Number SUA-1475" (Reclamation Plan) [Canonie Environmental Services Corp. (Canonie), 1991].

Final reclamation of the South Cell consisted of completing the radon attenuation soil cover, placing the erosion protection cover and constructing drainage swales over the reclaimed surface. The reclamation was performed from May to September 1995 and encompassed approximately 19.4 acres of the South Cell and surrounding areas. Work also continued on the Runoff Control Ditch located west of the tailings disposal area.

Construction of the final cover for the South Cell represents the third stage of final reclamation for the tailings disposal area. Final reclamation of the North Cell was previously completed in 1993 as documented in the "As-Built Report, North Cell Final Reclamation" (Canonie, 1994), and final reclamation of the Central Cell was previously completed in 1994 as documented in the "As-Built Report, Central Cell Final Reclamation" (Canonie, 1995). Interim stabilization of the entire tailings disposal area was previously completed from 1989 to 1991 and consisted of regrading the tailings and placing the interim soil cover. As-built reports for interim stabilization include the North Cell (Canonie, 1990), Central Cell [Western Technologies, Inc. (WT), 1991], South Cell (Canonie, 1992a) and Central Cell Addendum (Canonie, 1992b).

Sheet 2 shows the design plan view and Sheet 3 shows the design details for the installation of the final cover over the South Cell. Construction activities for this phase of the reclamation included:

1. Grubbing of the South Cell area to remove vegetation from the interim soil cover
2. Placing and compacting 9 inches of soil to complete the radon attenuation barrier
3. Covering the radon attenuation barrier with a minimum of 3 inches of rock
4. Placing and compacting soil over the rock cover
5. Constructing drainage swales and channels to control surface water runoff

These construction activities were performed in accordance with the design drawings (Sheets 2 and 3) and the specifications provided in Appendix B of the Reclamation Plan. Sheet 4 shows the as-built plan view of the final cover, surface water controls for the South Cell and the section of the Runoff Control Ditch constructed in 1995. Final reclamation of Borrow Pit No. 2, located east of the Central Cell, including completion of Branch Swales A, B and C, was also completed during the 1995 construction season. Details of the borrow pit reclamation are provided in a separate document titled "As-Built Report, Borrow Pit No. 2 Final Reclamation" [Smith Environmental Technologies Corporation (Smith Environmental), 1996].

Construction services for the reclamation activities were provided to United Nuclear by Nielson's General Contractors (Nielson's). Table 1 lists the equipment used by Nielson's during construction. The crushed rock for the erosion protection cover and the riprap and bedding material for the drainage swales and channels were provided by Hamilton Brothers, Inc. (Hamilton). WT provided geotechnical sampling and testing services. Appendix A provides WT's 1995 field reports of daily construction activities.

The following sections of this document describe the construction activities and quality control procedures implemented during construction of the radon attenuation layer, erosion protection cover and surface water controls. Copies of the geotechnical test results are provided in the appendices.

2.0 RADON ATTENUATION LAYER

The radon attenuation layer over the South Cell consists of 18 inches of compacted soil and is designed to reduce the long-term radon flux from the underlying tailings to 20 picoCuries per square meter per second (pCi/m²/sec). The 18-inch layer consists of the soil cover placed during interim stabilization activities in 1991 (Canonie, 1992a) plus the final lift of soil added during this phase of reclamation activities. The soil radon attenuation layer constructed during final reclamation activities was placed, compacted and tested as described below.

2.1 Construction Methods and Materials

Prior to placement of the final lift of the radon attenuation cover, the South Cell interim soil cover was grubbed of vegetation using scrapers and a motor grader. The grubbing removed an average of approximately 3 inches of soil from the top of the existing 12-inch interim cover, leaving an average of 9 inches of compacted soil cover in place. The top of the remaining interim cover was then scarified and moisture conditioned prior to placing the final soil cover to provide for adequate bonding between the interim and final soil covers. The thickness of the final cover averaged 9 inches, thereby bringing the total thickness of the radon attenuation cover to 18 inches.

The soil used to construct the final lift of the radon attenuation cover was obtained from the South Cell borrow area (see Sheet 4), which is located southeast of the South Cell. The soil within the stockpile ranges from a lean clay and sandy/silty clay to a silty sand and meets the soil classification requirements specified on Figure B-1 of the technical specifications presented in the Reclamation Plan. The soil was excavated and transported to the South Cell area using scrapers. Fine grading of the soil cover was performed using a motor grader.

The soil cover was conditioned to meet construction specifications by adding water and compacting. This process consisted of scarifying the soil with a roame plow and/or motor grader and spraying water on top of the soil using a water wagon. A sheepsfoot

compactor was used to obtain primary compaction. Afterwards the top of the soil layer was compacted using a smooth-drum roller.

The total volume of radon attenuation cover placed over the South Cell, excluding swale areas, was approximately 24,000 cubic yards (cy). This estimate is based on 19.4 acres of South Cell tailings area and an average final soil cover of 9 inches. The radon attenuation cover placed in the swale areas (less than 1 acre) was inspected and tested separately as described in Section 4.0 of this report. The 24,000 cy of soil cover was placed, moisture conditioned and compacted in 11 work days between July 6 and August 2, 1995, at an average rate of about 2,200 cy per work day.

2.2 Specifications and Testing

Construction specifications for placement of the radon attenuation cover, as stipulated in the Reclamation Plan, are listed below. Adherence to these specifications was maintained through strict survey control and geotechnical testing of soil properties and field density.

1. A total of 18 inches of soil cover shall be placed over the regraded tailings.
2. Soil used for the cover shall be clays, silts and fine-grained sands which fall within the gradation envelope shown on Figure B-1 of Appendix B.
3. The soil cover over the tailings is to be compacted to a minimum of 95 percent of the maximum dry density at a moisture content of within 2 percent above the optimum moisture content as determined by the Standard Proctor Compaction Method [American Society for Testing and Materials (ASTM) D 698].
4. The areas surrounding the tailings that are incorporated into the reclamation work, such as drainage swales in native soils, will be excavated and regraded in accordance with the construction drawings, and compacted to a minimum of 90 percent of the maximum dry density as determined by the Standard Proctor Compaction Method (ASTM D 698).

Subsequent sections discuss the survey control and geotechnical testing performed to verify that the radon attenuation cover was constructed in accordance with specifications.

2.2.1 Survey Control

During previous reclamation activities in 1991, the top of the South Cell tailings was graded to the design slope and a minimum of 12 inches of interim soil cover (i.e., the initial lift of the radon attenuation cover) were placed and compacted in accordance with the construction drawings and specifications (Canonie, 1992a). To insure that the final lift of soil cover was applied uniformly and that the required total cover thickness of 18 inches was achieved, the South Cell was surveyed on a 100-foot by 100-foot grid system both prior to and after grubbing of vegetation. Subtraction of the second set of surveyed elevations from the initial set of elevations determined the thickness of soil removed by grubbing. The thickness of the soil removed averaged 3 inches. A final lift of soil cover averaging 9 inches was then added to the remaining 9-inch interim cover, thereby bringing the total thickness of the radon attenuation cover to 18 inches.

Elevations for the final lift were established in the field by placing wooden stakes at each grid location with the top-of-grade marked by a blue ribbon. These top-of-grade stakes were checked frequently and reestablished as necessary during placement of the final soil cover.

2.2.2 Soil Properties

The suitability of the borrow soil for use in the radon attenuation cover was verified by performing gradation and Atterberg tests at 3 locations within the South Cell borrow area and at 30 locations distributed uniformly over the radon attenuation cover as the soil was placed. All of the tests indicated that the soil was within the specified gradation limits and met soil classification requirements. The testing frequency of 1 gradation test for every 730 cy of soil (i.e., 24,000 cy/33 gradation tests) exceeded the specified test rate of 1 test for every 1,000 cy placed. The laboratory reports

documenting the results of the gradation and Atterberg tests for the radon attenuation layer are presented in Appendix B.

2.2.3 Field Density

In-place field moisture-density testing of the soil cover was conducted using the sand-cone method (ASTM D 1556). A total of 52 locations distributed uniformly over the tailings soil cover were tested, of which 50 met the required density and moisture specifications on the initial test. The remaining 2 locations were recompact until additional testing confirmed that required minimum moisture-density standards were met. The test frequency of 1 moisture-density test for every 462 cy of soil (i.e., 24,000 cy/52 moisture-density tests) exceeds the specified test rate of 1 test for every 500 cy placed. The laboratory reports documenting the results of the moisture-density testing are presented in Appendix C.

The average dry density and moisture content of the 52 passing tests were 109.9 pounds per cubic foot (pcf) and 14.2 percent, respectively. This average dry density and in-situ moisture content are higher than the values used in the Reclamation Plan design of 108.0 pcf and 12.9 percent, respectively. The average values from the testing correspond to an in-situ porosity of 0.32 and a saturation of 78 percent, as compared to the design values of 0.33 and 68 percent for porosity and saturation, respectively. The higher density and degree of saturation of the radon attenuation layer will provide improved radon attenuating properties as compared to the mathematical model for the radon attenuation cover provided in the Reclamation Plan.

2.2.4 Proctor Tests

A total of 10 Standard Proctor tests were conducted during completion of the radon attenuation cover over the South Cell. The results of these tests are presented in Appendix D. The Standard Proctor tests were performed in accordance with ASTM D 698A to determine the relationship between moisture and density in the barrow soils over a range of moisture and density values.

The Reclamation Plan specifies that Standard Proctor tests be conducted for every 15 field density tests, and One-Point Proctor tests be performed for every 5 field density tests. The total of 10 Standard Proctor tests performed on the radon attenuation soil cover resulted in a testing frequency of one Standard Proctor test performed for every five field density tests. No One-Point Proctor tests were performed because the higher frequency for the Standard Proctor tests made such testing redundant.

3.0 EROSION PROTECTION COVER

The erosion protection cover consists of 6 inches or more of a soil/rock matrix placed on top of the radon attenuation soil cover. The soil/rock matrix is designed to promote surface water runoff and protect the underlying radon attenuation soil layer from wind and water erosion. The erosion protection cover was constructed over the entire area of the South Cell except for the drainage swales which were riprapped in accordance with the Reclamation Plan (refer to Section 4.0 for drainage swale construction). Construction methods, materials and testing for the erosion protection cover are described below.

3.1 Construction Methods and Materials

The soil/rock matrix was constructed by placing a minimum of 3 inches of rock mulch over the completed radon attenuation soil cover, then placing a 4- to 6-inch layer of random soil material over the rock mulch. The soil was then forced into the rock mulch voids to form the soil/rock matrix.

The rock mulch consisted of a basalt aggregate with a D_{50} of 1.5 inches. This same rock was also used as riprap in portions of the Runoff Control Ditch and drainage swales described in Section 4.0. Construction of the rock mulch layer consisted of dumping the rock directly from haul trucks and scrapers onto the top of the completed radon attenuation cover in a series of elongated parallel piles. A motor grader was then used to spread the rock to the required thickness of 3 inches or greater.

The 4 to 6 inches of soil placed on top of the rock mulch were obtained from the South Cell borrow area. This soil was excavated, transported and placed using scrapers. Afterwards, a pneumatic compactor was used to force the soil into the underlying rock mulch, thereby creating the required soil/rock matrix. Finish grading of the top of the completed cover was performed using a motor grader.

3.2 Specifications and Testing

Construction specifications for construction of the erosion protection cover as stipulated in the Reclamation Plan include:

1. The rock mulch is to be dense limestone or other suitable rock and is to meet the following criteria: specific gravity = 2.6 or greater; absorption = 1.8 percent or less; and sodium sulfate loss = 10 percent or less. Alternatively, the rock source shall have a minimum score of 50 using the scoring criteria shown in Table D1 of the August 1990 Staff Technical Position (STP), "Design of Erosion Protection Covers for Stabilization of Uranium Mill Tailings Sites" or equivalent, and shall be oversized, if needed, in accordance with the procedures provided in Appendix D of the August 1990 STP.
2. The rock mulch is to be placed a minimum of 3 inches thick and have a nominal D_{50} of 1.5 inches with the following size gradations: 100 percent passing a 3-inch screen; 8 to 37 percent passing a 1-inch screen; and, 0 to 8 percent passing a No. 4 screen.
3. The soil for the soil/rock matrix is to be a clayey sand to sandy clay with no more than 25 percent of the soil greater than 1/2-inch in diameter. The soil is to be placed in a 4- to 6-inch lift over the rock mulch and compacted a minimum of 2 inches into the rock mulch. After compaction, the top of the soil layer is to be a minimum of 3 inches and a maximum of 4.5 inches above the rock mulch.

Adherence to the specifications was maintained through geotechnical testing of the rock mulch and by measuring the rock mulch thickness, soil layer thickness, and the depth of soil penetration into the rock mulch as described below.

3.2.1 *Rock Mulch Quality*

The rock used to construct the rock mulch was a dense basalt rock with durability characteristics superior to the criteria stipulated in the technical specifications. A total

of 3 tests were performed on the "Basalt 1.5-inch Aggregate" to verify the rock's quality. The test results are presented in Appendix E. The average test values for the rock included a specific gravity of 2.75, an absorption of 1.5 percent, a sodium sulfate loss of 2.9 percent, and an L.A. Abrasion percentage of 4.9. The rock quality score for the 3 tests, using the scoring criteria provided in the August 1990 STP, ranged from 85 to 93 with an average score of 90.

The specifications require that rock quality tests be performed initially and for each additional 10,000 cy of rock placed. More frequent testing is also required if the rock characteristics in the rock borrow source vary significantly from the rock that was previously tested. United Nuclear's records show that in 1995 a total of 18,479 cy of D_{50} 1.5-inch rock were placed as rock mulch and riprap during final reclamation of the South Cell, the Runoff Control Ditch, and Borrow Pit No. 2. No change in rock characteristics was noted by the quality control technician. Therefore, the rock quality testing rate of 1 series of tests per 6,160 cy of rock placed (i.e., 18,479 cy/3 tests) exceeded the test rate required by the specifications.

3.2.2 *Rock Mulch Thickness and Size Gradation*

The basalt rock with a D_{50} of 1.5 inches that was used to construct the rock mulch and to riprap the surface water control structures was subjected to sieve analyses to determine if gradation requirements were being met. A total of 5 samples were tested at the quarry and 3 at the site prior to spreading. One of the samples collected and tested at the quarry did not meet gradation specifications and this material was not used. The remaining tests at the quarry and on the samples collected and tested at the site all met the gradation requirements. The results of the sieve analysis testing are presented in Appendix F.

The thickness of the rock mulch was checked and recorded on 50- to 100-foot centers over the entire extent of the South Cell tailings area. Areas having a measured thickness of less than 3 inches or greater than 5 inches were regraded by Nielson's and then rechecked to verify that a rock mulch thickness between 3 and 5 inches had been achieved. The recorded measurements are presented in Appendix G.

3.2.3 *Soil Thickness and Penetration*

The soil used to construct the soil/rock matrix was obtained from the South Cell borrow area. Gradation analyses performed for constructing the radon attenuation barrier (see Appendix B) indicates that this soil ranges from lean clay and sandy/silty clay to silty sand with an average of only 1 to 2 percent of the material greater than 1/2-inch in diameter. This soil is slightly finer than the clayey sand to sandy clay called for in the specifications. Use of the finer soil is an improvement on the design specification because it allows for greater penetration of the soil into the rock mulch and increases the cohesion of the soil/rock matrix.

The thickness of the soil layer and the depth of penetration of the soil into the rock mulch was checked on a uniform basis over the entire extent of the soil/rock matrix cover. The measurements were performed on staggered 100-foot centers. The results of the measurements are presented in Appendix H and show that the soil layer above the rock mulch was a minimum of 3 inches in all areas. In some areas, the soil layer thickness was increased in excess of 4.5 inches to provide adequate surface drainage. The depth of soil penetration into the rock mulch exceeded 2 inches in all areas.

4.0 SURFACE WATER CONTROL STRUCTURES

Surface water control structures associated with the South Cell include:

1. Branch Swales H, I and J
2. Runoff Control Ditch

Sheets 2 and 3 show the design details for these structures. Sheet 4 shows the as-built conditions for those portions completed during South Cell reclamation in 1995.

Branch Swales H, I and J are shallow, riprapped ditches located on top of the South Cell designed to convey runoff from the reclaimed tailings area to the South Cell Drainage Channel, which will be constructed in the future. Construction of those portions of Branch Swales H and J that pass through the Evaporation Pond area will also be constructed in the future when the Evaporation Ponds are reclaimed.

In conjunction with South Cell reclamation activities, work also continued on the Runoff Control Ditch between Stations 25+00 to 43+00 (Sheet 4). This ditch, located west of the tailings area, is designed to intercept runoff from the west embankment of the North, Central and South Cells.

4.1 Branch Swales H, I, and J

Branch Swales H, I, and J were constructed on top of the South Cell at the locations shown on Sheet 4. These swales are designed to collect surface water runoff while minimizing erosion on the rock mulch cover. As shown on Sheet 3, the swales consist of shallow, trapezoidal ditches with 3H/1V sideslopes. Both the bottom and sideslopes of the swales are armored with riprap.

Sheet 4 presents the extent of swale completion at the end of 1995 construction activities. Swale I was completed in 1995, while Swales H and J were partially

completed. Swales H and J are designed to extend further to the north across the present location of the evaporation ponds.

4.1.1 Construction Methods and Materials

The initial step in swale construction was to excavate down to the required subgrade elevation. Swale excavation was performed using scrapers and included removal of material along the length of each swale. The swales were excavated to a designed bottom width of 10 or 20 feet with 3H/1V sideslopes. A motor grader was used for fine grading to achieve the required final subgrade elevations. During excavation of the swales, the following 3 types of subgrade material were found below the interim cover:

1. Fill soil which had been placed during interim reclamation activities to achieve the design grade for the base of the interim soil cover.
2. Native soils located along the southeastern edge of the South Cell.
3. Coarse tailings sands which were used as the initial cover over the fine tailings sands. These coarse tailings, when encountered, were overexcavated and replaced with fill soil from the Borrow Pit No. 2 soil stockpile. The excavated tailings were disposed of in Borrow Pit No. 2 in compacted lifts as specified in the Reclamation Plan.

The soil comprising the subgrade was tested to verify its in-place density. Any areas not meeting density requirements were subjected to additional compaction until the required density was achieved. Exposed soils were also monitored for radon emissions. After completion of the subgrade, a radon attenuation layer was placed over the bottom and sideslopes of the lower section of Swale I. The total thickness of the radon attenuation layer in this area, including the interim cover, measured a minimum of 18 inches. Each lift of the radon attenuation layer was conditioned by adding water and compacted with a sheepsfoot compactor followed by a smooth-drum roller. Placement of a radon attenuation layer was not required in the upper reaches of Swale I and in Swales H and J

because they were constructed southeast of the tailings area in native soils and fill derived from the Borrow Pit No. 2 soil stockpile.

Prior to installation of the riprap, a 3-inch-thick bedding layer having a D_{50} of 0.02 inch was placed in the swales. This bedding layer or filter blanket is designed to prevent undercutting and piping beneath the riprap during surface runoff events. An additional 3-inch bedding layer having a D_{50} of 0.35 inch was placed in Swales H and I in accordance with the design specifications. All bedding layers were placed using a front-end loader and spread to a uniform thickness using hand rakes. A minimum of 3 inches of riprap was then placed on top of the bedding material in Swale J. A minimum of 6 inches of riprap was placed in Swales H and I. The riprap was placed using a front-end loader, hand rakes, and a trackhoe.

4.1.2 *Specifications and Testing*

Specifications for construction of the branch swales as stipulated in the Reclamation Plan include:

1. The swales are to be constructed as shown on Sheets 2 and 3 and in accordance with the design parameters listed in Table 2.
2. The subgrade is to be compacted to a minimum of 90 percent of the maximum dry density as determined by ASTM D 698.
3. A total of 18 inches of radon attenuation soil cover shall be placed over the subgrade within the tailings area. This soil cover is to have gradation characteristics within the gradation envelope shown on Figure B-1 (see Appendix B) and compacted to a minimum of 95 percent of the maximum dry density at a moisture content of within 2 percent above the optimum moisture content as determined by ASTM D 698.

4. A minimum 3-inch-thick bedding layer consisting of well-graded crushed rock with a D_{50} of 0.02 inch is to be placed on the bottom and sideslopes of each swale.
5. A second bedding layer consisting of a minimum 3-inch thickness of well-graded crushed rock with a D_{50} of 0.35 inch is to be placed on the bottom and sideslopes of Swales H and I.
6. A minimum of 3 inches of riprap consisting of durable rock with a D_{50} of 1.5 inches is to be placed on top of the bedding layer in Swale J.
7. A minimum of 6 inches of riprap consisting of durable rock with a D_{50} of 3 inches is to be placed on top of the bedding layer in Swales H and I.

Adherence to the specifications was maintained through strict survey control, geotechnical testing of soil and rock properties, and measuring of in-place densities and depths of cover.

4.1.2.1 Field Modifications

Prior to the start of final reclamation of the South Cell, United Nuclear conducted a detailed review of the reclamation plan requirements for construction of the branch swales. This review identified several areas where minor modifications of the South Cell Swales were necessary to match the swale design to the as-built topography of the interim cover and surrounding areas. These minor modifications were developed by Canonie using NRC guidelines and were incorporated into the construction design as a field change. The modifications affecting branch swale construction are shown in parentheses in Table 2. Appendix I provides the details of the design modifications for the South Cell swales.

4.1.2.2 Survey Control

Survey control for construction of the branch swales consisted of installing grade stakes through the middle of each swale and at 10-foot offsets on each side of the swale. Grade stakes were installed on 100-foot centers and cuts and fills were determined by subtracting the thickness of the radon attenuation layer (where appropriate), bedding layer and riprap from the final required elevation. Surveying was performed within a precision level of plus or minus 0.05 foot.

After the initial excavation was completed, each swale was resurveyed and blue grade stakes were installed indicating the cuts and fills required to achieve final grade elevations. Installation of these "blue topped" finish grade stakes were necessary because the swales slopes are extremely flat having average grades of less than 1 percent. After the finish-grading was completed, the elevations of the subgrade were checked at each survey station to verify that positive drainage was being maintained.

Swale I was again surveyed after placement of the radon attenuation layer. This survey served two purposes:

1. Verify that a minimum of 18 inches of radon attenuation soil cover had been placed.
2. Verify that positive drainage was being maintained in each swale.

Surveying of the bedding layer and riprap in each swale was not necessary because the thickness of these components was verified by measurements made on 100-foot centers as described in Sections 4.1.2.5 and 4.1.2.6.

4.1.2.3 Subgrade Density Testing

In-place field density testing of the swale subgrade was conducted using the sand cone method (ASTM D 1556). The subgrade consisted of both fill soils and native soils. A total of 12 locations spaced over the swales were tested, of which 11 met the required

density of 90 percent of the maximum dry density as determined by ASTM D 698 on the initial test. The remaining location was subjected to additional compaction and met density requirements on the retest.

The Reclamation Plan specifies that Standard Proctor tests be conducted for every 15 field density tests, and One-Point Proctor tests be performed for every 5 field density tests. A total of 5 Standard Proctor tests were performed on the subgrade material resulting in a testing frequency of 1 Standard Proctor test performed for every 2.4 field density tests. No One-Point Proctor tests were performed because the higher frequency for the Standard Proctor tests made such testing redundant.

The results of the Standard Proctor and field density tests for the subgrade material are presented in Appendix J.

4.1.2.4 Radon Attenuation Layer Testing

As required in the Reclamation Plan, the radon attenuation layer was placed over the lower portion of Swale I. The upper portion of Swale I and Swales H and J did not require a radon attenuation layer because of their location beyond the limits of tailings. Construction of the radon attenuation layer over Swale I required the placement and compaction of approximately 500 cy of soil from the South Cell borrow area. The volume of soil used in constructing the radon attenuation layer in these swales was estimated by multiplying the area of Swale I covered by the radon attenuation layer (about 0.2 acre) by the depth of the compacted soil cover (18 inches). After soil placement and compaction, the radon attenuation layer was tested to verify that the soil met gradation requirements and that density and moisture specifications were also being met. These test results are summarized below and presented in detail in Appendix J.

One gradation test was performed on the radon attenuation soils placed in Swale I. The results were within the gradation requirements illustrated on Figure B-1 in Appendix B of the Reclamation Plan. The test frequency of 1 test per 500 cy of soil placed exceeded the specified test frequency of 1 test per 1,000 cy of soil placed.

Two in-place field moisture-density tests of the radon attenuation soil cover in Swale I were performed using the sand cone method (ASTM D 1556). These tests were performed at the upper and lower ends of the covered portion of the swale. Both of the tests met the requirement for a minimum of 95 percent of the maximum dry density at a moisture content of within 2 percent above the optimum moisture content. The test frequency of 1 test for every 250 cy of soil (i.e., 500 cy/2 tests) exceeded the specified test frequency of one test for every 500 cy of soil.

4.1.2.5 Bedding Layer Testing

Bedding material was placed at a minimum thickness of 3 inches on the bottom and sides of all the swales. The bedding material consisted of crusher fines from Hamilton's stockpile and had a nominal D_{50} of 0.02 inch. The bedding layer thickness was verified in the field by measuring the depth of the bedding layer on the swale bottom and sides every 100 feet. The results of these measurements are presented in Appendix J and show that the bedding layer ranged from 3 to 3.5 inches thick in all swales.

In accordance with the Reclamation Plan, a second bedding layer was placed on top of the D_{50} 0.02-inch bedding layer in Swales H and I. The second layer of bedding material consisted of crushed basalt aggregate from Hamilton's pit and had a nominal D_{50} of 0.35 inch. Its thickness was also verified in the field by measuring the total depth of both bedding layers on the swale bottom and sides every 100 feet. The results of these measurements are presented in Appendix J and show that the depth of the second bedding layer ranged from 3 to 4 inches thick in Swales H and I.

Three sieve analyses were performed to determine the gradation characteristics of the D_{50} 0.02-inch bedding material used in constructing the branch swales and the upper reach of the Runoff Control Ditch. The results of the sieve analyses are presented in Appendix K and confirm that the bedding material met the gradation specifications of 100 percent passing a 3-inch screen, 85 to 100 percent passing a 3/4-inch screen, 65 to 100 percent passing a No. 4 screen, 47 to 94 percent passing a No. 10 screen, 23 to 70 percent passing a No. 40 screen, and 15 to 30 percent passing a No. 200 screen.

Eight sieve analyses were performed to determine the gradation characteristics of the D_{50} 0.35-inch bedding material used in constructing Branch Swale H. The results of the sieve analyses are presented in Appendix K. The first 5 sieve analyses did not meet the gradation requirements, and the tested material was discarded. Results of the last 3 tests confirm that the bedding material met the gradation specifications of 65 to 100 percent passing a 3-inch screen, 43 to 80 percent passing a 3/4-inch screen, 22 to 60 percent passing a No. 4 screen, 15 to 38 percent passing a No. 10 screen, 5 to 12 percent passing a No. 40 screen, and 0 to 10 percent passing a No. 200 screen.

The D_{50} 0.35-inch bedding material exceeded the durability specifications for aggregate with rock quality characteristics similar to the 1.5-inch rock aggregate (see Section 3.2). The average test values for the rock included a specific gravity of 2.74, an absorption of 1.9 percent, a sodium soundness loss of 4.1 percent, and an L.A. Abrasion percentage of 3.6. The rock quality scores for the test, using the scoring criteria provided in the August 1990 STP, ranged from 80 to 90, with an average score of 84.7. The three rock quality tests for the D_{50} 0.35-inch aggregate are presented in Appendix E.

4.1.2.6 Riprap Testing

Two sizes of riprap were used during construction of the branch swales associated with the South Cell. In accordance with the reclamation plan, riprap with a D_{50} of 1.5 inches was used in Swale J, and riprap with a D_{50} of 3 inches was used in Swales H and I.

1.5-Inch Riprap

Riprap consisting of a basalt rock with a D_{50} of 1.5 inches was placed at a minimum thickness of 3 inches on the bottom and sides of Swale J. Riprap thickness was verified by measuring the depth of the riprap on the swale bottom and sides every 100 feet. The results of these measurements are presented in Appendix J and show that all measurement were in excess of the 3-inch minimum.

The rock used for the riprap was the same basalt rock used to construct the rock mulch. As discussed in Section 3.2.1, this rock has superior durability characteristics with an

average rock quality score of 90. Sieve analyses of this rock were also performed as discussed in Section 3.2.2, to maintain the size gradation in conformance with the specifications. Rock quality and gradation test results for the riprap are provided in Appendices E and F, respectively.

Three-Inch Riprap

In accordance with the specifications of the reclamation plan, riprap consisting of a basalt rock with a D_{50} of 3 inches was placed at a minimum thickness of 6 inches on the bottom and sides of Swales H and I. Riprap thickness was verified by measuring the depth of the riprap on the swale bottom and sides every 100 feet. The results of these measurements are presented in Appendix J and show that all measurements met or exceeded the 6-inch minimum.

The rock used as riprap in Swales H and I was a dense basalt rock with durability characteristics superior to the criteria stipulated in the technical specifications. The specifications for rock quality characteristics of the D_{50} 3-inch rock are identical to those for the D_{50} 1.5-inch rock outlined in Section 3.2. Three tests were performed to verify the rock's quality. The test results are presented in Appendix E. The average test values for the rock included a specific gravity of 2.74, an absorption of 1.7 percent, a sodium soundness loss of 2.6 percent, and an L.A. Abrasion percentage of 3.9. Using the scoring criteria provided in the August 1990 STP, the rock quality scores for the test ranged from 83 to 90, with an average score of 87.3.

The specifications require that a series of rock durability tests be performed initially and for each additional 10,000 cy of rock placed. More frequent testing is also required if the rock characteristics in the rock borrow source vary significantly from the rock that was previously tested. United Nuclear's records show that a total of 2,554 cy of D_{50} 3-inch rock was placed as riprap during 1995. No change in rock characteristics was noted by the quality control technician. Three rock quality tests were conducted, or 1 for each 850 cy of rock used. Therefore, the rock quality testing rate exceeds the test rate required by the specifications.

The basalt rock with a D_{50} of 3 inches that was used to riprap Swales H and I was also subjected to 8 sieve analyses to ensure that gradation requirements were being met. The following size gradations were required for the D_{50} 3-inch rock: 100 percent passing a 6-inch screen; 45-67 percent passing a 4-inch screen; and 0-22 percent passing a 1-inch screen. Four of the samples did not meet these requirements, and the material was rejected. The remaining tests showed that the material was within specifications. The results of the sieve analysis testing are presented in Appendix F.

4.2 Runoff Control Ditch

The Runoff Control Ditch is located immediately west of the tailings disposal area as shown on Sheet 4. During 1995, construction of the Runoff Control Ditch continued in a southerly direction from Stations 25+00 to 43+00. The upper reach of the Runoff Control Ditch was completed to Station 25+00 in 1993 and 1994 as part of the North Cell and Central Cell Final Reclamation. The ditch is designed to collect surface water runoff from the west embankment of the tailings area. As shown on Sheet 3, the Runoff Control Ditch is 2 feet deep with a 10-foot-wide bottom and 3H/1V and 5H/1V sideslopes.

4.2.1 Construction Methods and Materials

The Runoff Control Ditch was excavated down to the required subgrade elevation using scrapers and dozers. A motor grader was used for fine grading to achieve the required final subgrade elevations. The native soils at the bottom and sides of the ditch were then compacted as necessary with a sheepsfoot compactor and a smooth drum roller to achieve the required soil density.

After the subgrade met the in-place density specifications, a minimum of 3 inches of bedding material having a D_{50} of 0.02 inch was placed in the ditch using a front-end loader. The bedding material was spread using hand rakes. A second bedding layer of rock aggregate with a D_{50} of 0.35 inch was then placed to a minimum depth of 3 inches in the lower reach of the Runoff Control Ditch (i.e., from Stations 38+00 to 43+00). Subsequently, the upper reach was covered with a minimum of 3 inches of riprap having

a D_{50} of 1.5 inches and the lower reach was covered with a minimum of 6 inches of riprap having a D_{50} of 3 inches.

4.2.2 Specifications and Testing

The specifications for construction of the Runoff Control Ditch as stipulated in the Reclamation Plan include:

1. The ditch is to be constructed as shown on Sheets 2 and 3.
2. The subgrade is to be compacted to a minimum of 90 percent of the maximum dry density as determined by ASTM D 698.
3. A minimum 3-inch-thick bedding layer consisting of well-graded crushed rock with a D_{50} of 0.02 inch is to be placed on the bottom and sideslopes.
4. A second bedding layer consisting of a minimum 3-inch thickness of well-graded crushed rock with a D_{50} of 0.35 inch is to be placed on the bottom and sideslopes of the lower reach.
5. A minimum of 3 inches of riprap consisting of durable rock with a D_{50} of 1.5 inches is to be placed on top of the bedding layer in the upper reach.
6. A minimum of 6 inches of riprap consisting of durable rock with a D_{50} of 3 inches is to be placed on top of the bedding layer in the lower reach.

Adherence to the specifications was maintained through strict survey control, geotechnical testing of soil and rock properties, and measuring of in-place densities and depths of cover.

4.2.2.1 Survey Control

Survey control for construction of the Runoff Control Ditch from Station 25+00 to Station 43+00 consisted of installing grade stakes through the middle of the ditch and at 10-foot offsets on each side of the ditch. The grade stakes were installed on 100-foot centers and cuts and fills for the ditch bottom were determined by subtracting the profile elevations shown on Sheet 3 from the existing elevations. Cuts and fills to achieve the 3H/1V sideslopes of the ditch and 5H/1V slope of the protective bench were also marked at each station. Surveying was performed within a precision level of plus or minus 0.05 foot.

After the excavation was completed to the subgrade, the ditch was surveyed again to verify that the required grades had been achieved. Surveying of the bedding layer and riprap was not necessary because the thickness of these components were verified by measurements made on 100-foot centers as described in Sections 4.2.2.3 and 4.2.2.4.

4.2.2.2 Subgrade Density Testing

In-place field density testing of the ditch subgrade was conducted using the sand cone method (ASTM D 1556). A total of 10 locations spaced uniformly over the ditch bottom and east and west berms were tested, all of which met the required density of 90 percent of the maximum dry density as determined by ASTM D 698.

The Reclamation Plan specifies that Standard Proctor tests be conducted for every 15 field density tests, and One-Point Proctor tests be performed every 5 field density tests. A total of 2 Standard Proctor tests were performed on the subgrade material resulting in a testing frequency of 1 Standard Proctor test performed for every 5 field density tests. No One-Point Proctor tests were performed because the higher frequency for the Standard Proctor tests made such testing redundant.

The results of the Standard Proctor and field density tests for the subgrade material are presented in Appendix L.

4.2.2.3 Bedding Layer Testing

Bedding material was placed at a minimum thickness of 3 inches on the bottom and sides of the ditch prior to installation of riprap. The bedding material consisted of crusher fines from Hamilton's stockpile and had a nominal D_{50} of 0.02 inch. The bedding layer thickness was verified in the field by measuring the depth of the bedding layer on the swale bottom and sides every 100 feet. The results of these measurements are presented in Appendix L and show that the bedding layer ranged from 3 to 3.5 inches thick over the entire length of the ditch.

In accordance with the Reclamation Plan, a second bedding layer was placed on top of the D_{50} 0.02-inch bedding layer in the lower reach of the Runoff Control Ditch (i.e., from Stations 38 + 00 to 43 + 00). The second layer of bedding material consisted of crushed basalt aggregate from Hamilton's pit and had a nominal D_{50} of 0.35 inch. A minimum of 3 inches of this coarser bedding material in the lower reach was verified in the field by measuring its depth on the ditch bottom and sides every 100 feet. The results of these measurements are presented in Appendix L and show that the depth of the second bedding layer ranged from 3 to 4 inches thick in the lower reach.

Sieve analyses and rock quality testing indicate that the bedding material met gradation and durability specifications. These analyses and tests are discussed in Section 4.1.2.5 with the results presented in Appendices K and E, respectively.

4.2.2.4 Riprap Testing

Riprap consisting of a basalt rock with a D_{50} of 1.5 inches was placed at a minimum thickness of 3 inches on the bottom and sides of the upper reach of the ditch (i.e., Stations 25 + 00 to 38 + 00). Riprap consisting of a basalt rock with a D_{50} of 3.0 inches was placed at a minimum thickness of 6 inches on the bottom and sides of the lower reach of the ditch (i.e., Stations 38 + 00 to 43 + 00). Riprap thickness was verified by measuring the depth of the riprap every 100 feet. The results of these measurements are presented in Appendix L and show that all measurements were in excess of the minimum thickness requirements.

The rock used for the riprap was the same basalt rock used to construct the rock mulch. As discussed in Sections 3.2.1 and 4.1.2.6, this rock has superior durability characteristics with rock quality scores between 83 and 93. Sieve analyses of this rock were performed as discussed in Section 3.2.2 and Section 4.1.2.6, to maintain the size gradation in conformance with the specifications. Rock quality and gradation test results for the riprap are provided in Appendices E and F, respectively.

5.0 CLOSING REMARKS

The South Cell of the tailings disposal facility has been reclaimed in accordance with the specifications and construction drawings contained in the Reclamation Plan (Canonie, 1991). This reclamation included construction of the radon attenuation layer, erosion protection cover and surface water controls.

Smith Environmental Technologies Corporation appreciates this opportunity to provide engineering services for the reclamation construction and as-built conditions documentation regarding work conducted during 1995 in the South Cell Tailings Disposal Area at the Church Rock Facility. If you have any questions, please contact me at (303) 790-1747.

Respectfully submitted,



Bruce W. Hassinger, P.G.
Project Manager

BWH/ajw

REFERENCES



REFERENCES

Canonie Environmental Services Corp., 1990, "As-Built Construction Report, North Cell Interim Stabilization", prepared for United Nuclear Corporation, Church Rock Facility, Gallup, New Mexico.

Canonie Environmental Services Corp., 1991, "Tailings Reclamation Plan as Approved by NRC March 1, 1991, License No. SUA-1475", prepared for United Nuclear Corporation, Church Rock Facility, Gallup, New Mexico.

Canonie Environmental Services Corp., 1992a, "As-Built Report, South Cell Interim Stabilization", prepared for United Nuclear Corporation, Church Rock Facility, Gallup, New Mexico.

Canonie Environmental Services Corp., 1992b, "As-Built Report Addendum, Central Cell Interim Stabilization", prepared for United Nuclear Corporation, Church Rock Facility, Gallup, New Mexico.

Canonie Environmental Services Corp., 1994, "As-Built Report, North Cell Final Reclamation", prepared for United Nuclear Corporation, Church Rock Facility, Gallup, New Mexico.

Canonie Environmental Services Corp., 1995, "As-Built Report, Central Cell Final Reclamation", prepared for United Nuclear Corporation, Church Rock Facility, Gallup, New Mexico.

Nuclear Regulatory Commission, 1990, "Staff Technical Position, Design of Erosion Protection Covers for Stabilization of Uranium Mill Tailings Sites", August.

Smith Environmental Technologies Corporation, 1996, "As-Built Report, Borrow Pit No. 2 Final Reclamation", prepared for United Nuclear Corporation, Church Rock Facility, Gallup, New Mexico.

Western Technologies, Inc., 1991, "As-Built Construction Report, Interim Stabilization, Central Cell Tailings Disposal Area", prepared for United Nuclear Corporation, Church Rock Facility, Gallup, New Mexico.

TABLES



TABLE 1

EARTHMOVING EQUIPMENT

Equipment Type	Number
Caterpillar 633 Scrapers	2
Caterpillar 825 Sheepsfoot Compactor	1
Caterpillar D-8 Dozer	1
Caterpillar EL 300 Excavator	1
Caterpillar 14G Graders	1
Caterpillar 950B Front-End Loaders	2
Caterpillar 631 Water Wagon	1
End Dump Trucks	2
Belly Dump Trucks	2
Water Truck	1

TABLE 2
SWALES H, I, AND J
DESIGN PARAMETERS

Parameter	Swale H		Swale I		Swale J	
		(2,350)	550	(750)	1,900	(1,700)
Length (ft)	2,550	(0.010)	0.0040	(0.0067)	0.0047	
Slope (ft/ft)	0.0085		20		10	
Bottom Width (ft)	20		3.5		2.5	
Minimum Depth (ft)	2.5		0.02, Layer 1 0.35, Layer 2		0.02	
Bedding Layer D ₅₀ (in)	3, Layer 1 3, Layer 2		3, Layer 1 3, Layer 2		3	
Riprap D ₅₀ (in)	3.0		3.0		1.5	
Riprap Thickness (in)	6		6		3	



Notes:

- The sides of the swales are to be installed at a slope of 3H/1V.
- Values shown in parentheses are field design modifications. See Appendix I for additional details.



FIGURES


FIGURES

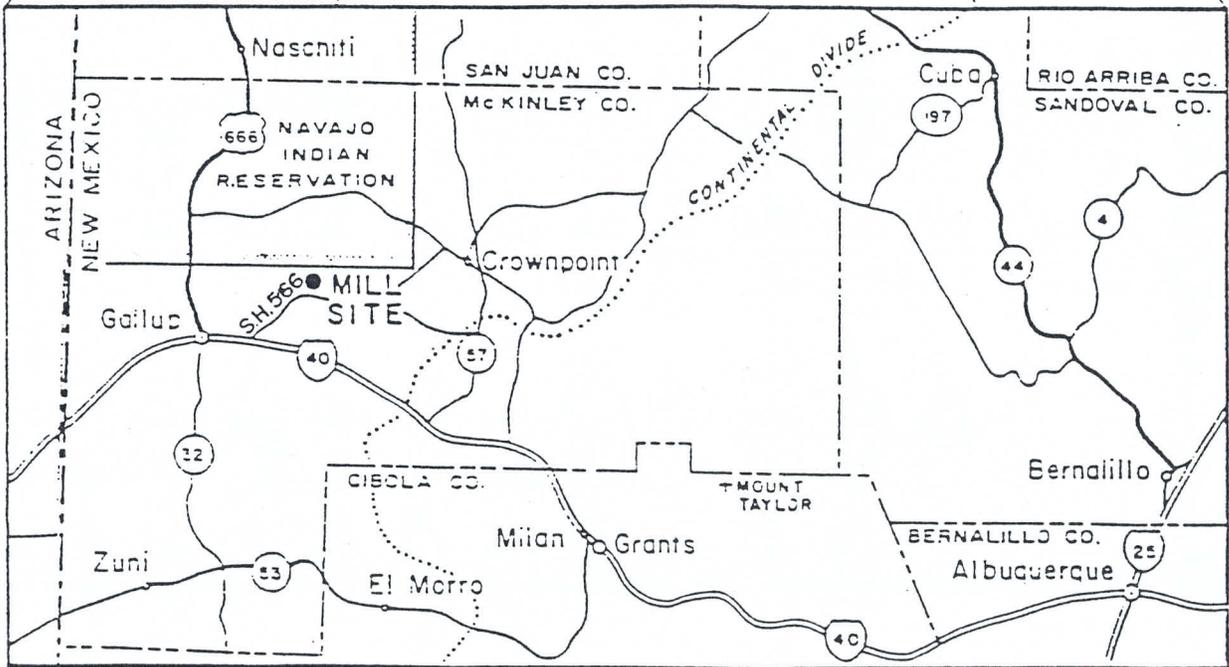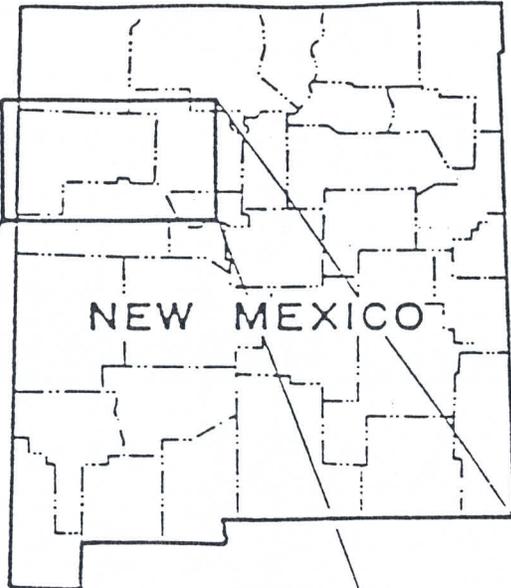

NOTES:

1. AFTER DRAWING No. RM86-060-A24 (FIGURE) 1-1 IN THE 1987 RECLAMATION PLAN (CANONIE, 1987b).

REFERENCE:
URANIUM MILL LICENSE RENEWAL APPLICATION- ENVIRONMENTAL REPORT LICENSE No. NM-UNC-ML. UNC 1981.

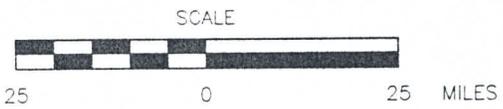


SITE VICINITY MAP
PREPARED FOR
UNC MINING AND MILLING
GALLUP, NEW MEXICO



No.	DATE	ISSUE / REVISION	DWN. BY	CK'D BY	AP'D BY	ISSUED FOR AS-BUILT CONSTRUCTION REPORT SOUTH CELL RECLAMATION	RLM	DATE: 2-19-96	DRAWING NUMBER 86-060-A1032
						SCALE: AS SHOWN	SHEET 1		

86-060-B593
DRAWING NUMBER 86-060-E1047

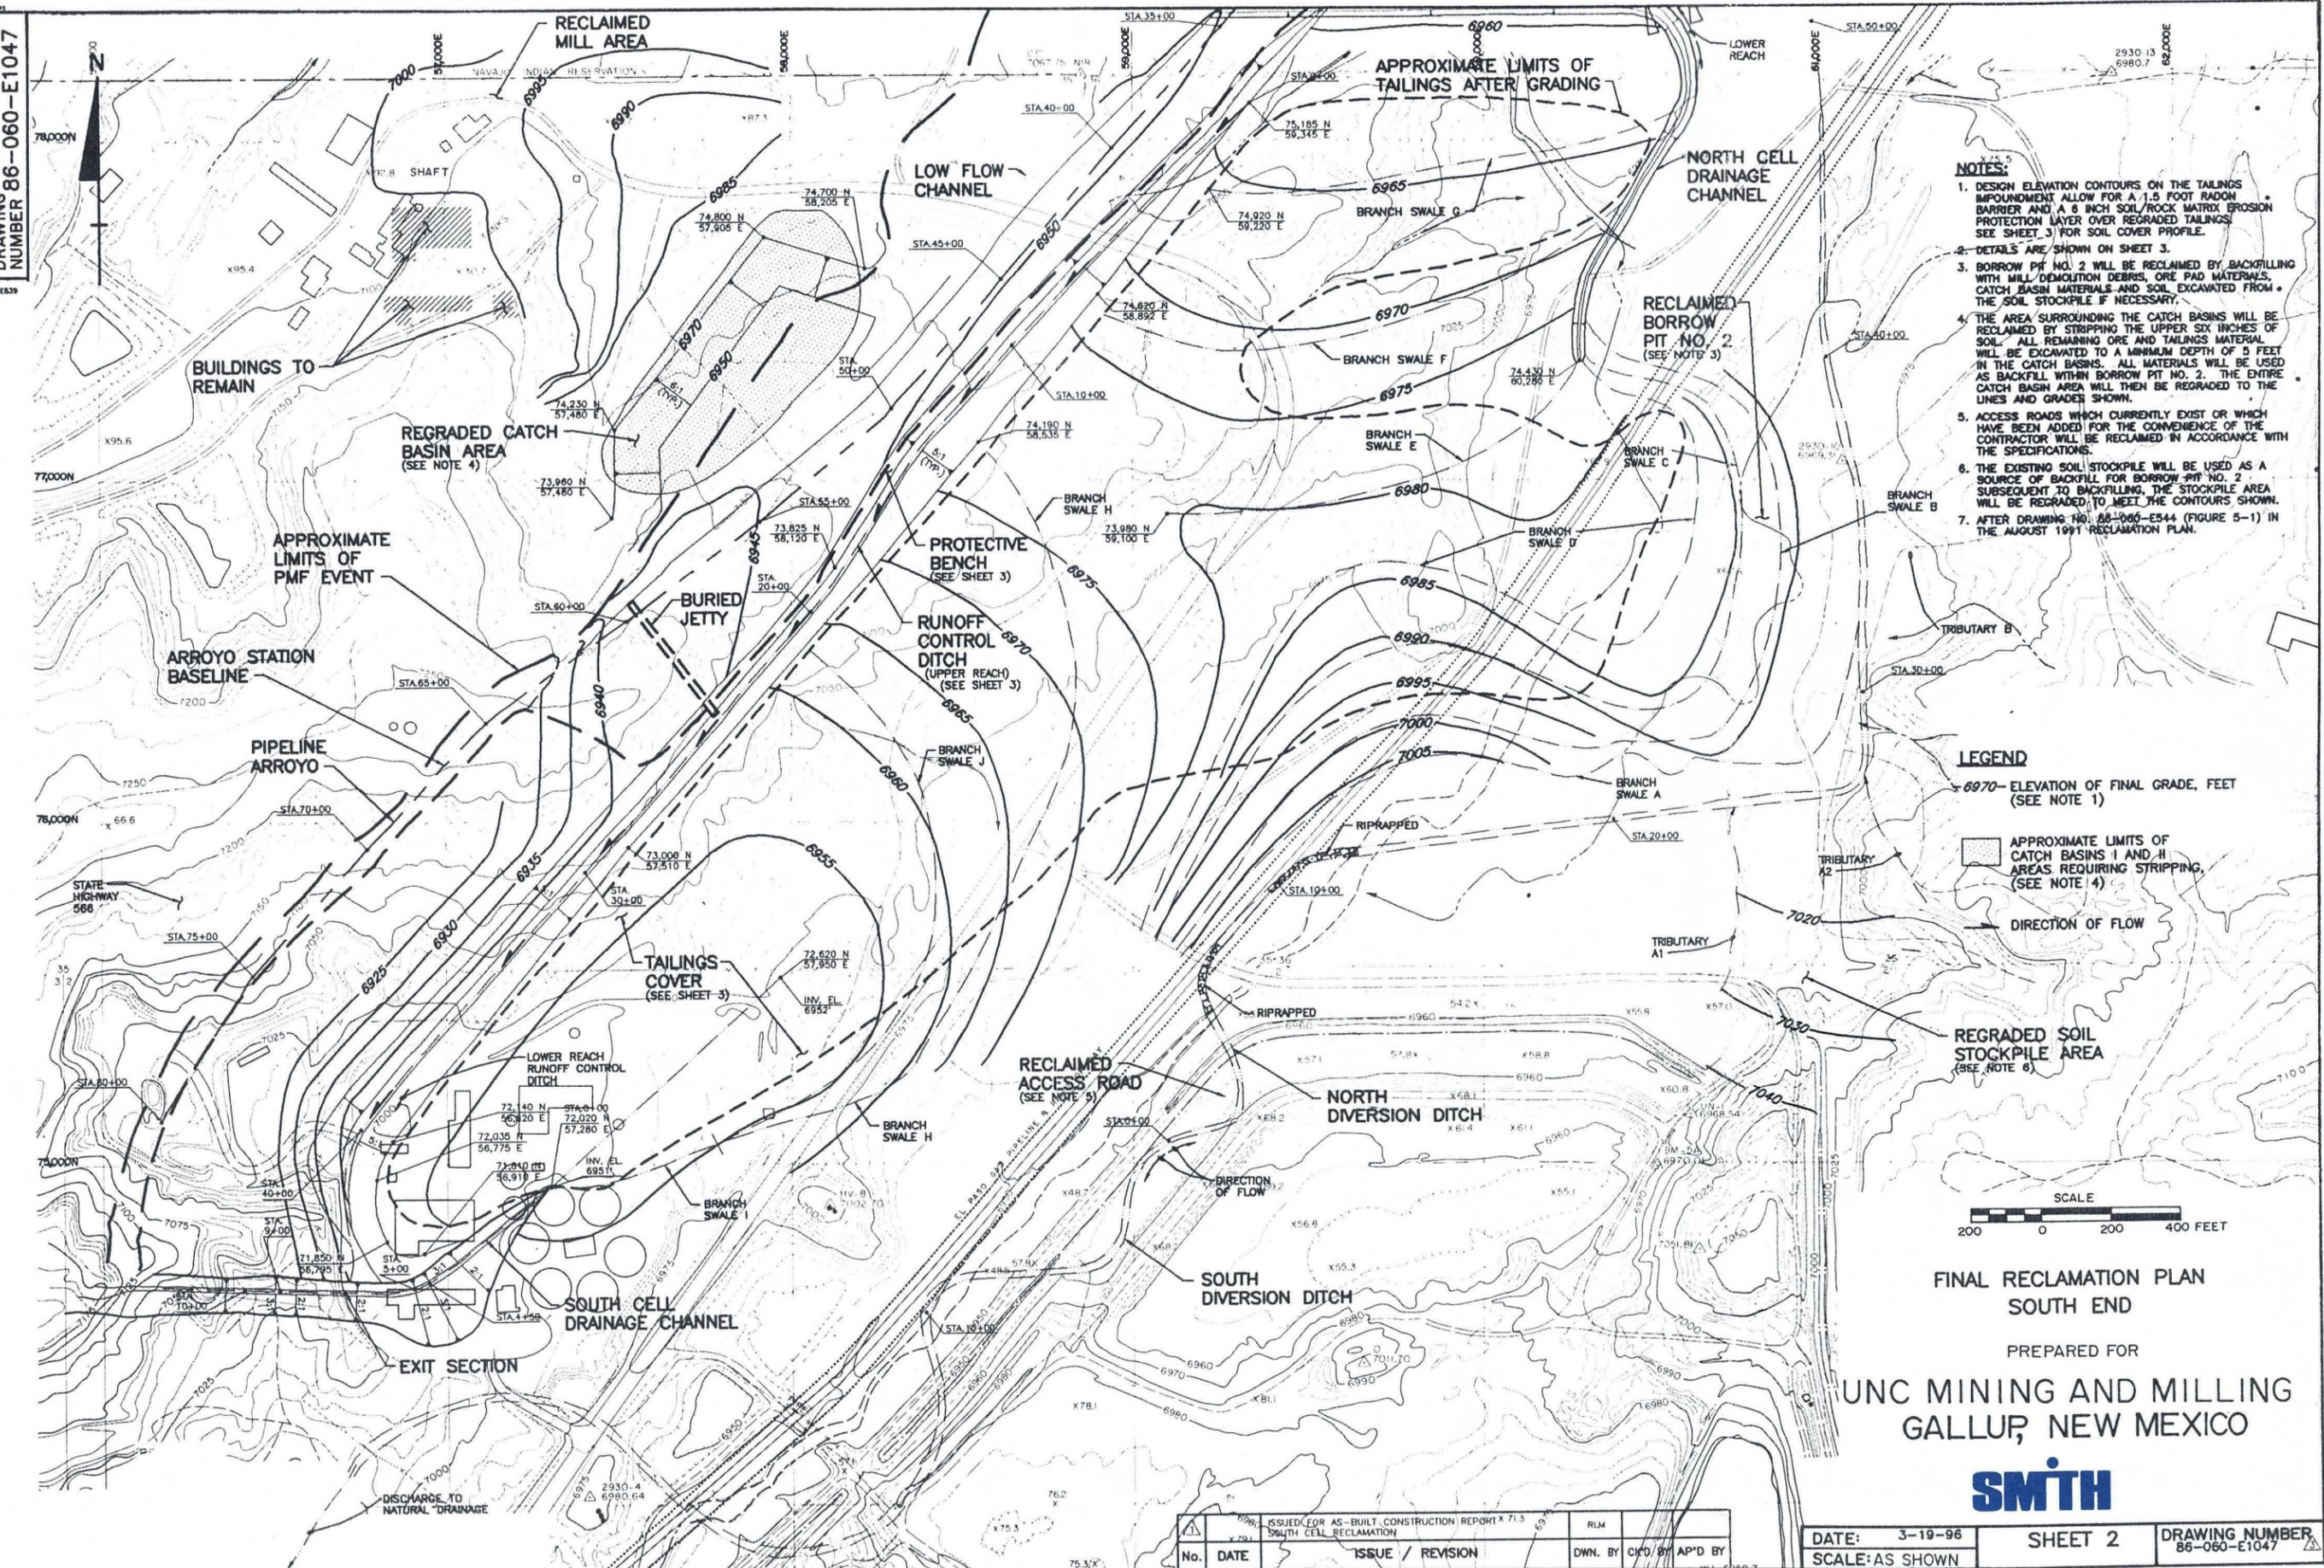

- NOTES:**
- DESIGN ELEVATION CONTOURS ON THE TAILINGS IMPOUNDMENT ALLOW FOR A 1.5 FOOT RADON BARRIER AND A 6 INCH SOIL/ROCK MATRIX EROSION PROTECTION LAYER OVER REGRADED TAILINGS. SEE SHEET 3 FOR SOIL COVER PROFILE.
 - DETAILS ARE SHOWN ON SHEET 3.
 - BORROW PIT NO. 2 WILL BE RECLAIMED BY BACKFILLING WITH MILL/DEMOLITION DEBRIS, ORE PAD MATERIALS, CATCH BASIN MATERIALS AND SOIL EXCAVATED FROM THE SOIL STOCKPILE IF NECESSARY.
 - THE AREA SURROUNDING THE CATCH BASINS WILL BE RECLAIMED BY STRIPPING THE UPPER SIX INCHES OF SOIL. ALL REMAINING ORE AND TAILINGS MATERIAL WILL BE EXCAVATED TO A MINIMUM DEPTH OF 5 FEET IN THE CATCH BASINS. ALL MATERIALS WILL BE USED AS BACKFILL WITHIN BORROW PIT NO. 2. THE ENTIRE CATCH BASIN AREA WILL THEN BE REGRADED TO THE LINES AND GRADES SHOWN.
 - ACCESS ROADS WHICH CURRENTLY EXIST OR WHICH HAVE BEEN ADDED FOR THE CONVENIENCE OF THE CONTRACTOR WILL BE RECLAIMED IN ACCORDANCE WITH THE SPECIFICATIONS.
 - THE EXISTING SOIL STOCKPILE WILL BE USED AS A SOURCE OF BACKFILL FOR BORROW PIT NO. 2. SUBSEQUENT TO BACKFILLING, THE STOCKPILE AREA WILL BE REGRADED TO MEET THE CONTOURS SHOWN.
 - AFTER DRAWING NO. 86-060-E544 (FIGURE 5-1) IN THE AUGUST 1991 RECLAMATION PLAN.

- LEGEND**
- 6970- ELEVATION OF FINAL GRADE, FEET (SEE NOTE 1)
 - APPROXIMATE LIMITS OF CATCH BASINS I AND II AREAS REQUIRING STRIPPING. (SEE NOTE 4)
 - DIRECTION OF FLOW
 - REGRADED SOIL STOCKPILE AREA (SEE NOTE 6)




FINAL RECLAMATION PLAN
SOUTH END
PREPARED FOR
UNC MINING AND MILLING
GALLUP, NEW MEXICO




No.	DATE	ISSUE / REVISION	DWN. BY	CHK'D BY	AP'D BY
1		ISSUED FOR AS-BUILT CONSTRUCTION REPORT X 71.5 SOUTH CELL RECLAMATION	RLM		

DATE: 3-19-96
SCALE: AS SHOWN
SHEET 2
DRAWING NUMBER 86-060-E1047

86-060-B593

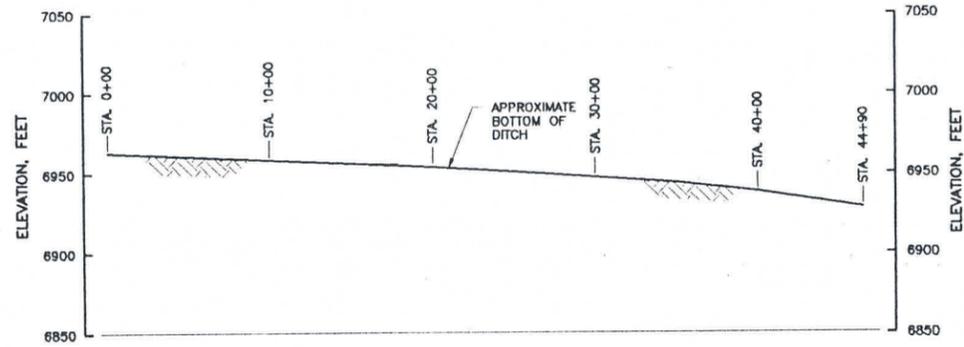


PROFILE
RUNOFF CONTROL DITCH

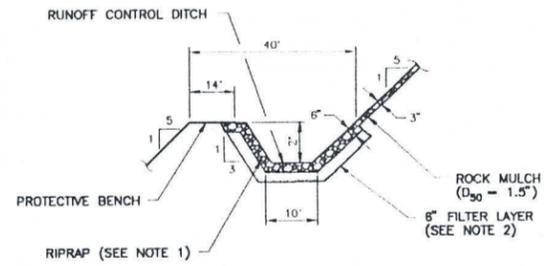

NOTES:

1. RIPRAP $D_{90} = 1.5"$ IN UPPER REACH OF RUNOFF CONTROL DITCH. $D_{90} = 3.0"$ IN LOWER REACH OF RUNOFF CONTROL DITCH.
2. RIPRAP LAYER $3"$ AND FILTER LAYER $3"$ IN UPPER REACH OF RUNOFF CONTROL DITCH.


TYPICAL SECTION
RUNOFF CONTROL DITCH
(LOOKING NORTHEAST)
NOT TO SCALE

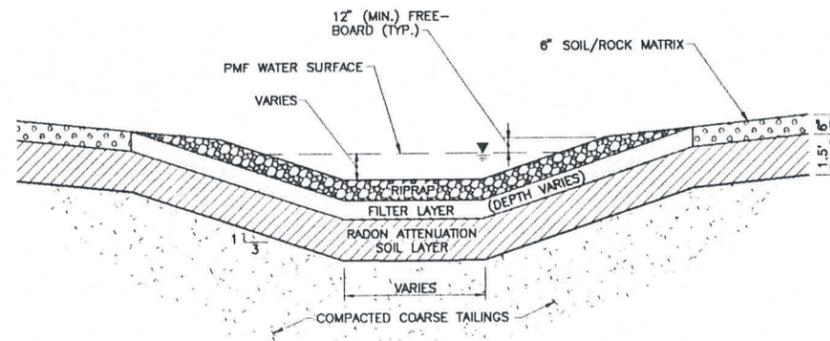

TYPICAL BRANCH SWALE
NOT TO SCALE

NOTE:

1. BRANCH SWALE DIMENSIONS AND RIPRAP SIZES PROVIDED IN TABLE 2.

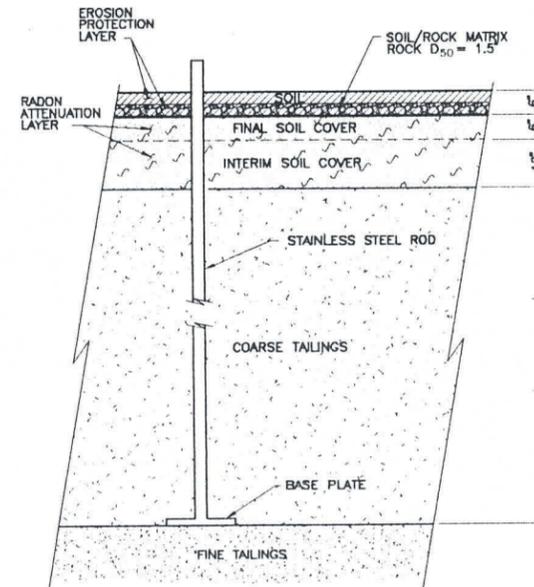

SOIL COVER PROFILE
NOT TO SCALE

NOTES:

1. AFTER DRAWINGS 86-060-E569 (FIGURE 5-3) AND 86-060-E565 (FIGURE 5-4) IN THE AUGUST, 1991 RECLAMATION PLAN.
2. THE FINAL SOIL COVER WAS INCREASED FROM 6 INCHES TO 9 INCHES OVER THE CENTRAL CELL. THIS MINOR MODIFICATION TO THE PLAN WAS IMPLEMENTED AS A FIELD CHANGE.

SOIL COVER AND
SURFACE WATER CONTROL DETAILS
PREPARED FOR
UNC MINING AND MILLING
GALLUP, NEW MEXICO



△	ISSUED FOR AS-BUILT CONSTRUCTION REPORT SOUTH CELL FINAL RECLAMATION	RLM		
No.	DATE	ISSUE / REVISION	DWN. BY	CK'D BY

DATE:	2-19-96	SHEET 3	DRAWING NUMBER	86-060-E1034
SCALE:	AS SHOWN			