



302 W. 5th Street, Suite 310
San Pedro, CA 90731
Tel: (310) 519-4000
Fax: (310) 519-4029

29 July 2015

Ms. Hamide Kayaci, Remedial Project Manager, HPNS
Base Realignment and Closure Program Management Office, West
33000 Nixie Way, Bldg 50
San Diego, California 92147

Subject: Monthly Landfill Gas Monitoring Letter Report for July 2015
Post-Removal Action, Parcel E-2 Industrial Landfill
Hunters Point Naval Shipyard, San Francisco, California
Contract Number N62473-09-D-2626
Contract Task Order 0007

Dear Ms. Kayaci,

The routine monthly landfill gas monitoring event at Parcel E-2 was performed on Tuesday, July 28, 2015. For this event, monitoring via GEM-2000 landfill gas analyzer and photo-ionization detector was performed at gas monitoring probe locations GMP08A, GMP23 and GMP24. GMP08A is located along the fence line of the perimeter of the landfill while GMP23 and GMP24 are located within the UCSF compound as shown on Figure 1.

The results for the routine monthly monitoring event were as follows:

Methane

- Methane was detected by the field monitoring equipment in GMP08A, GMP23, and GMP24 at 0.0%, 0.4%, and 0.0% by volume in air, respectively

Per the project's Final Interim Landfill Gas Monitoring and Control Plan (TetraTech, 2004), the methane action levels are as follows:

- The HPNS action level for GMPs along the fence line, in the UCSF compound, and along Crisp Ave. is 2.5% by volume in air
- The regulatory action level for the concentration of methane gas migrating from the landfill must not exceed 5% by volume in air at the property boundary or an alternative boundary approved in accordance with 27 CCR §20925

Since all methane readings were below the action levels during this monitoring period, no further action is required.

NMOCs

- NMOCs were detected by the field monitoring equipment in GMP08A, GMP23, and GMP24 at 0.0 ppmv, 0.8 ppmv, and 0.0 ppmv, respectively

Per the project's Final Interim Landfill Gas Monitoring and Control Plan (TetraTech, 2004), the NMOC action level at these locations is as follows:

- 500 ppmv in GMPs

Since all NMOC readings were below the action level during this monitoring period, no further action is required.

Monitoring-Related Notes

- The GEM-2000 landfill gas analyzer was checked for calibration before and after this monitoring event

The above monitoring information will be included in the Quarterly Report for the third calendar quarter of 2015, to be prepared in October 2015.

The field data sheet and a figure of the monitoring points for this project are included in this report. Please let me know if you have comments or questions about this monitoring event or the data included herein. You can reach me at (310) 519-4000 or by e-mail at howard@ckyinc.com.

Sincerely,



Howard Wittenberg
CKY Inc., Project Manager

Enclosures: Field Data Sheet
 Figure of Monitoring Points

Landfill Gas Monitoring Log


Name: Brian Weeks

Weather: sunny

Sampling Location		Date	Time	Temp (°F)	Barometric Pressure (in. Hg)	GEM-2000				PID		Soil Gas Pressure (in. H ₂ O)	Notes (e.g., active extraction, flow rate, probe damage, instrument issues)
Location ID	Description (for example, GMP, Well, Carbon, Hydrosil)					Methane (%)	CO ₂ (%)	O ₂ (%)	Percent of LEL	Non-Methane VOCs (ppmv)	Bckgrd. NMOCs (ppmv)		
GMP08A	Gas Monitoring Probe	7/28/15	737	71	29.84	0.0	8.3	0.7	0.0	0.0	0.0	0.0	
GMP23	Gas Monitoring Probe	7/28/15	801	66	29.83	0.4	16.6	0.7	7.0	0.8	0.0	0.0	
GMP24	Gas Monitoring Probe	7/28/15	808	67	29.83	0.0	15.8	0.8	0.0	0.0	0.0	0.0	

Legend:

%:	percent by volume in air	NA:	not applicable
°F:	degrees Fahrenheit	NMOC:	non-methane organic compound
CO ₂ :	carbon dioxide	O ₂ :	oxygen
GEM-2000:	CES-LANDTEC landfill gas meter	PID:	photoionization detector
in. Hg:	inches of mercury	ppmv:	parts per million by volume
in. H ₂ O:	inches of water	VOC:	volatile organic compound
LEL:	lower explosive limit		

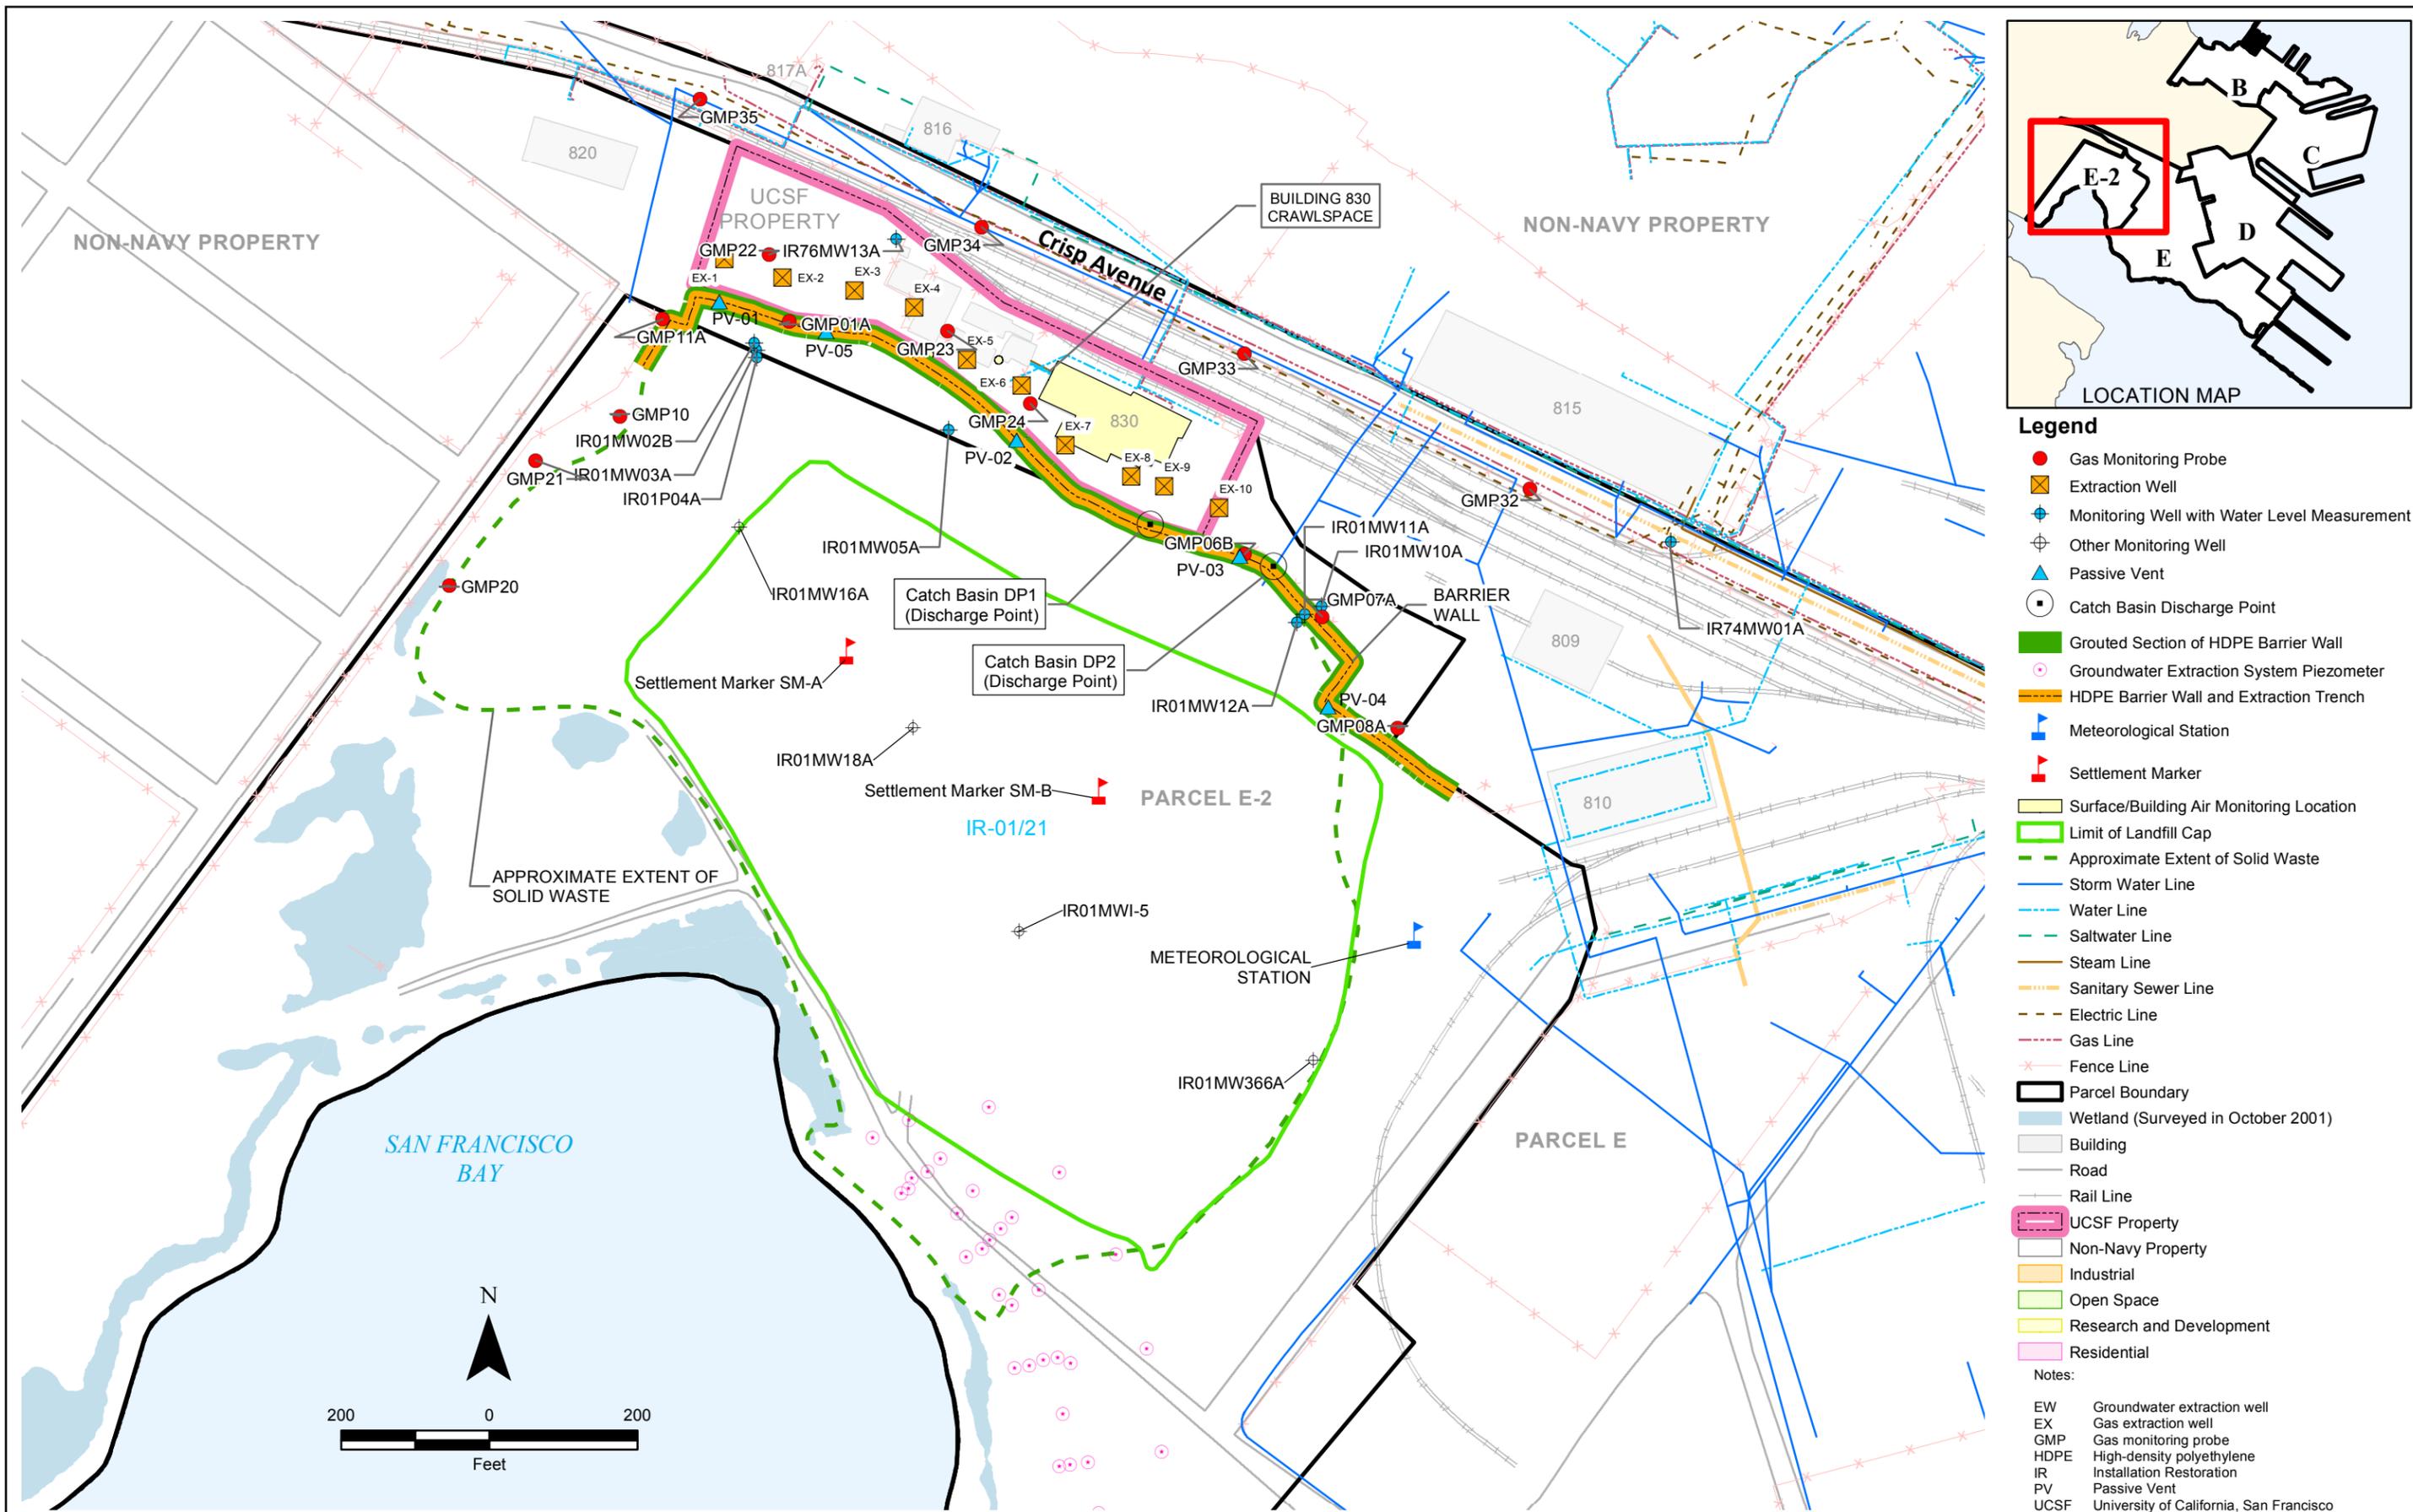

- Legend**
- Gas Monitoring Probe
 - ⊠ Extraction Well
 - ⊕ Monitoring Well with Water Level Measurement
 - ⊕ Other Monitoring Well
 - ▲ Passive Vent
 - ⊙ Catch Basin Discharge Point
 - Grouted Section of HDPE Barrier Wall
 - Groundwater Extraction System Piezometer
 - HDPE Barrier Wall and Extraction Trench
 - ⊕ Meteorological Station
 - ▴ Settlement Marker
 - Surface/Building Air Monitoring Location
 - Limit of Landfill Cap
 - Approximate Extent of Solid Waste
 - Storm Water Line
 - Water Line
 - Saltwater Line
 - Steam Line
 - Sanitary Sewer Line
 - Electric Line
 - Gas Line
 - Fence Line
 - ▭ Parcel Boundary
 - Wetland (Surveyed in October 2001)
 - ▭ Building
 - ▭ Road
 - ▭ Rail Line
 - ▭ UCSF Property
 - ▭ Non-Navy Property
 - ▭ Industrial
 - ▭ Open Space
 - ▭ Research and Development
 - ▭ Residential
- Notes:
- EW Groundwater extraction well
 - EX Gas extraction well
 - GMP Gas monitoring probe
 - HDPE High-density polyethylene
 - IR Installation Restoration
 - PV Passive Vent
 - UCSF University of California, San Francisco



Monthly Landfill Gas Monitoring Report
 Hunters Point Naval Shipyard
 San Francisco, California

FIGURE 1
 Site Map and
 Landfill Gas Monitoring Locations